

PIC16F818/819

PIC16F818/819 Rev. B0 Silicon Errata Sheet

The PIC16F818/819 Rev. B0 parts you have received conform functionally to the Device Data Sheet (DS39598**E**), except for the anomalies described below.

All of the issues listed here will be addressed in future revisions of the PIC16F818/819 silicon.

The following silicon errata apply only to PIC16F818/819 devices with these Device/Revision IDs:

Part Number	Device ID	Revision ID
PIC16F818	00 0100 110	00101
PIC16F819	00 0100 111	00101

Note: Non-TSL and TSL devices have the same Device and Revision IDs.

1. Module: Internal RC Oscillator IOFS bit

The device data sheet states when an INTOSC frequency is selected (125, 250, 500 kHz, 1, 2, 4, 8 MHz), the frequency will be stable when the IOFS bit becomes set (IOFS = 1) at 4 ms. The following applies for applications relying on time dependent code.

Under the following conditions, any of the INTOSC frequencies may not be stable when IOFS becomes set (IOFS = 1). Devices may vary from one to the next and may take as long as 60 ms to become stable.

- 1. Wake from Sleep, internal RC oscillator is selected via the Configuration Word and the IRCF bits are configured for an INTOSC frequency.
- 2. POR is executed, internal RC oscillator is selected via the Configuration Word and the IRCF bits are configured for an INTOSC frequency.

3. The INTRC (31.25 kHz) is clocking the device and a switch to an INTOSC frequency is executed via modification of the IRCF bits.

Work around

Implement the following software delay shown in Example 1 after an INTOSC frequency has been enabled and before any frequency dependent application code is executed. This routine will delay application execution approximately 2K-150K TCY (instruction cycles are dependent upon the INTOSC frequency) to ensure a stable INTOSC frequency.

Date Codes that pertain to this issue:

All date codes.

Note: This issue applies to TSL and non-TSL devices.

DlyVarH equ <define address based on application requirements> DlyVarL equ <define address based on application requirements> ;Load the delay variable DlyVarH with the following value for the selected frequency: ;125kHz 0x0300 ;250kHz 0x0600 ;500kHz 0x0C00 ;1MHz 0x1900 ;2MHz 0x3100 ;4MHz 0x6200 ; insure the correct data memory bank is selected delav ; for access of data variables CLRF DlyVarL ; initialize low delay variable MOVLW 0x62 ; initialize high delay variable MOVWF DlyVarH dly_loop DECFSZ DlyVarL,f ;decrement low variable GOTO dly_loop DECFSZ DlyVarH,f ;decrement high variable GOTO dly_loop RETURN ;delay done

2. Module: Internal RC Oscillator

When any one of the seven INTOSC frequencies is enabled by the following conditions, it is possible for the oscillator to overshoot the selected frequency.:

- 1. A clock switch from INTRC (31 kHz) to an INTOSC (125 kHz–8 MHz) frequency via the IRCF bits (OSCCON register).
- 2. Exit from Sleep mode with the IRCF bits already configured for an INTOSC frequency.

If the selected frequency is 8 MHz, then the Voltage versus Frequency specification of the device may be violated.

Work around

When it is required for the application to run at 8 MHz, it is recommended that the application does not start executing code at 8 MHz until the 60ms firmware delay (see issue 1) has completed. During the 60 ms settling period, the application can execute code up to 4 MHz. Upon completion of the 60 ms firmware delay, the 8 MHz can be selected via the IRCF bits.

Date Codes that pertain to this issue:

All date codes.

3. Module: PORTB Pull-ups

When RBPU = 0 (OPTION register), the PORTB weak pull-ups will not be disabled by the input functions of the SSP and/or CCP (Capture mode) module as indicated by the RB1:RB5 I/O block diagrams in **Section 5.0 "I/O Ports"**.

Work around

1. If the SSP and/or CCP (Capture mode) module is enabled, do not enable the PORTB weak pull-ups and use external pull-up resistors.

OR

 If the SSP and/or CCP (capture mode) module and PORTB pull-ups are enabled, then evaluate the functionality of the SSP (I²CTM/SPITM) or CCP (Capture mode) module to ensure proper operation within your application.

Date Codes that pertain to this issue:

All date codes.

4. Module: PORTB

A delay of 1 Tosc will occur if an instruction that modifies the contents of PORTB simultaneously occurs when any of the following modules (if enabled) executes an operation that effects the signals on their respective PORTB I/O pins.

CCP Module:

PWM Mode (CCP1CON<3:0> = 11xx)

When CCP1CON<5:4> bits = 10, the PWM output signal will be delayed by 1 Tosc when an instruction to modify the contents of PORTB is executed.

SSP Module:

SPI Slave Modes (SSPCON<3:0> = 0100 and 0101)

Clock signal is derived from an external source. Transmission of data (SDO pin) will be delayed by 1 Tosc when an instruction to modify the contents of PORTB is executed. Reception of data is not affected.

Work around

None

Date Codes that pertain to this issue:

All date codes.

Clarifications/Corrections to the Data Sheet

In the Device Data Sheet (DS39598**E**), the following clarifications and corrections should be noted.

None.

REVISION HISTORY

Rev A Document (09/2004)

First revision of this document, silicon issues 1 (Internal RC Accuracy), 2 (Internal RC Oscillator IOFS bit) and 3 (PORTB Pull-ups) and Data Sheet Clarification issue 1 (Timer1 Oscillator and In-Circuit Serial Programming).

Rev B Document (10/2004)

Removed silicon issue 1 (Internal RC Oscillator Accuracy), amended silicon issue 2 – now issue 1 (Internal RC Oscillator IOFS bit), added new issue 2 (Internal RC Oscillator), added silicon issue 4 (PORTB). Removed Data Sheet Clarification issue 1 (Timer1 Oscillator and In-Circuit Serial Programming).

PIC16F818/819

NOTES:

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as "unbreakable."

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WAR-RANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip's products as critical components in life support systems is not authorized except with express written approval by Microchip. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights.

Trademarks

The Microchip name and logo, the Microchip logo, Accuron, dsPIC, KEELOQ, microID, MPLAB, PIC, PICmicro, PICSTART, PRO MATE, PowerSmart, rfPIC, and SmartShunt are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.


AmpLab, FilterLab, MXDEV, MXLAB, PICMASTER, SEEVAL, SmartSensor and The Embedded Control Solutions Company are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Analog-for-the-Digital Age, Application Maestro, dsPICDEM, dsPICDEM.net, dsPICworks, ECAN, ECONOMONITOR, FanSense, FlexROM, fuzzyLAB, In-Circuit Serial Programming, ICSP, ICEPIC, Migratable Memory, MPASM, MPLIB, MPLINK, MPSIM, PICkit, PICDEM, PICDEM.net, PICLAB, PICtail, PowerCal, PowerInfo, PowerMate, PowerTool, rfLAB, rfPICDEM, Select Mode, Smart Serial, SmartTel and Total Endurance are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

All other trademarks mentioned herein are property of their respective companies.

© 2004, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

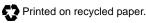

QUALITY MANAGEMENT SYSTEM CERTIFIED BY DNV ISO/TS 16949:2002

Microchip received ISO/TS-16949:2002 quality system certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona and Mountain View, California in October 2003. The Company's quality system processes and procedures are for its PICmicro® 8-bit MCUs, KEELoo® code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.



Worldwide Sales and Service

AMERICAS

Corporate Office 2355 West Chandler Blvd. Chandler, AZ 85224-6199 Tel: 480-792-7200 Fax: 480-792-7277 Technical Support: http:\\support.microchip.com Web Address: www.microchip.com

Atlanta Alpharetta, GA Tel: 770-640-0034 Fax: 770-640-0307

Boston Westford, MA Tel: 978-692-3848 Fax: 978-692-3821

Chicago Itasca, IL Tel: 630-285-0071 Fax: 630-285-0075

Dallas Addison, TX Tel: 972-818-7423 Fax: 972-818-2924

Detroit Farmington Hills, MI Tel: 248-538-2250 Fax: 248-538-2260

Kokomo Kokomo, IN Tel: 765-864-8360 Fax: 765-864-8387

Los Angeles Mission Viejo, CA Tel: 949-462-9523 Fax: 949-462-9608

San Jose Mountain View, CA Tel: 650-215-1444 Fax: 650-961-0286

Toronto Mississauga, Ontario, Canada Tel: 905-673-0699 Fax: 905-673-6509

ASIA/PACIFIC

Australia - Sydney Tel: 61-2-9868-6733 Fax: 61-2-9868-6755

China - Beijing Tel: 86-10-8528-2100 Fax: 86-10-8528-2104

China - Chengdu Tel: 86-28-8676-6200 Fax: 86-28-8676-6599

China - Fuzhou Tel: 86-591-750-3506 Fax: 86-591-750-3521

China - Hong Kong SAR Tel: 852-2401-1200 Fax: 852-2401-3431

China - Shanghai Tel: 86-21-5407-5533 Fax: 86-21-5407-5066 China - Shenyang Tel: 86-24-2334-2829 Fax: 86-24-2334-2393

China - Shenzhen Tel: 86-755-8203-2660 Fax: 86-755-8203-1760

China - Shunde Tel: 86-757-2839-5507 Fax: 86-757-2839-5571

China - Qingdao Tel: 86-532-502-7355 Fax: 86-532-502-7205 ASIA/PACIFIC

India - Bangalore Tel: 91-80-2229-0061 Fax: 91-80-2229-0062

India - New Delhi Tel: 91-11-5160-8632 Fax: 91-11-5160-8632

Japan - Kanagawa Tel: 81-45-471- 6166 Fax: 81-45-471-6122

Korea - Seoul Tel: 82-2-554-7200 Fax: 82-2-558-5932 or 82-2-558-5934

Singapore Tel: 65-6334-8870 Fax: 65-6334-8850

Taiwan - Kaohsiung Tel: 886-7-536-4818

Fax: 886-7-536-4803 Taiwan - Taipei Tel: 886-2-2500-6610 Fax: 886-2-2508-0102

Taiwan - Hsinchu Tel: 886-3-572-9526 Fax: 886-3-572-6459

EUROPE

Austria - Weis Tel: 43-7242-2244-399 Fax: 43-7242-2244-393

Denmark - Ballerup Tel: 45-4420-9895 Fax: 45-4420-9910

France - Massy Tel: 33-1-69-53-63-20 Fax: 33-1-69-30-90-79

Germany - Ismaning Tel: 49-89-627-144-0 Fax: 49-89-627-144-44

Italy - Milan Tel: 39-0331-742611 Fax: 39-0331-466781

Netherlands - Drunen Tel: 31-416-690399 Fax: 31-416-690340

England - Berkshire Tel: 44-118-921-5869 Fax: 44-118-921-5820

09/27/04